

CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

NORTH QUARTER Corner of Section 21, Township 39, Range 23, 4TH P.M.
 STATE OF MINNESOTA, County of KANABEC


At the corner location shown on the sketch:
 11/14/2011 SET A 1/2" IRON PIPE WITH ALUMINUM CAP AT
 INTERSECTION OF FENCES NORTH, SOUTH AND WEST.

Kanabec County U.S. Survey Feet Coordinates
 NAD 1983, HARN 1996 Adjustment
 Obtained by RTK GPS Observation

Northing= 147849.10
 Easting= 419674.46

Note: NAD 1983, HARN 1996 Adjustment
 coordinates are NOT compatible with
 NAD 1983 coordinates
 Note: 1 Meter=3937/1200 U.S. Survey Feet

SKETCH OF REFERENCE TIES

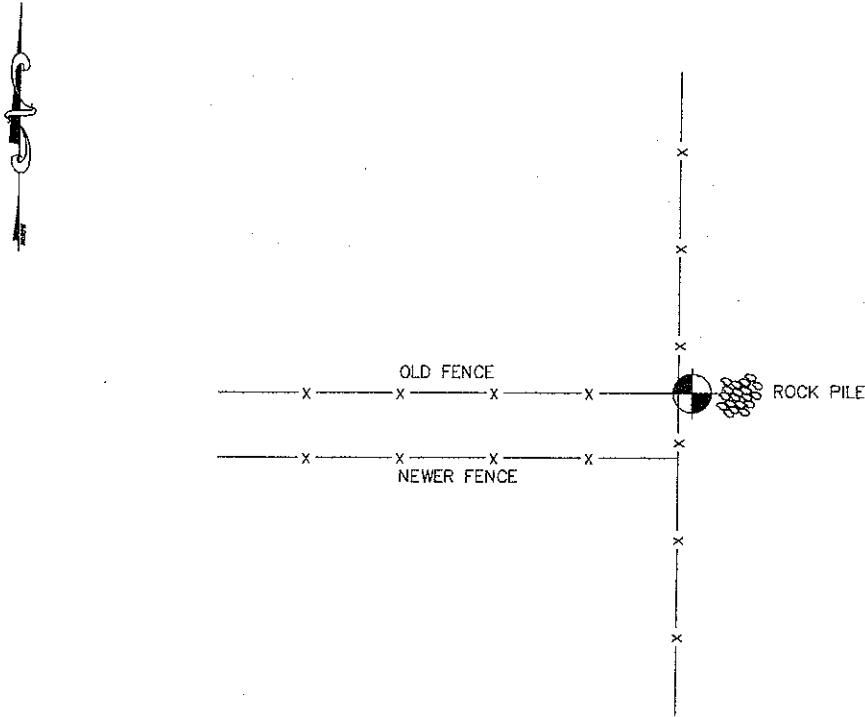

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

Ernest J. Paul
 Signature

12-21-2011
 Date

Registration No. 9808

Land Surveyor, Professional Engineer
 County Surveyor, County Engineer

OFFICE OF THE COUNTY RECORDER

County of _____

I hereby certify that this document was filed in the County Recorder's office at _____ M. on the _____ day of _____ A.D., 20____

County Recorder _____
 BY _____ Deputy

DOCUMENT NO. _____

N1/4 CORNER, SEC. 21, T39, R23

STATEMENT OF EVIDENCE

THE ORIGINAL GOVERNMENT CORNER WAS SET BY DEPUTY SURVEYOR SILAS BARNARD IN SEPT 1855 AND BEARING TREES NOTED AS:

**8" POPLAR @ 47 LINKS BEARING S48°W
NO OTHER TIES AVAILABLE.**

NO RECORDS OF ANY SUBSEQUENT SURVEYS COULD BE FOUND AT THE KANABEC COUNTY OFFICES.

ON NOVEMBER 14, 2011, E.G. RUD AND SONS SURVEYED A TRACT IN THE NW1/4 OF SEC. 16 AND HAD TO ESTABLISH THIS CORNER. THIS CORNER FALLS ON FENCE LINE RUNNING NORTH-SOUTH AND AN OLD FENCE LINE RUNNING WEST. ON THE EAST SIDE THERE IS A ROCK PILE RUNNING EAST-WEST. WE REMOVED SEVERAL STONES AND PROBED WITH A MACHETE AND 1/4" PROBE BUT COULD NOT FIND ANY EVIDENCE FOR THIS CORNER. THEREFORE WE ACCEPTED THE FENCE INTERSECTION AS THE BEST EVIDENCE FOR THE PERPETUATION OF THIS CORNER. THIS FIT WELL WITH THE SE CORNER OF SEC. 16 AND THE CENTERLINE OF THE ROAD AND DITCH AT THE SW CORNER OF SEC. 16. A 1/2" IRON PIPE WITH AN ALUMINUM CAP WAS SET, AND KANABEC COUNTY COORDINATES WERE ESTABLISHED ON THIS POSITION.