

# CERTIFICATE OF LOCATION OF GOVERNMENT CORNER

N<sup>1</sup>/<sub>4</sub> Corner of Section 15, Township 40, Range 23 4<sup>TH</sup> P.M.

STATE OF MINNESOTA, County of KANABEC

At the corner location shown on the sketch:

*Set 1/2" iron pipe on E of old road bed & fence to south based on parole evidence.*

Kanabec County U.S. Survey Feet Coordinates  
NAD 1983, HARN 1996 Adjustment  
Obtained by RTK GPS Observation


Northing= 185062.52

Easting= 425002.06

Note: NAD 1983, HARN 1996 Adjustment coordinates are NOT compatible with NAD 1983 coordinates

Note: 1 Meter=3937/1200 U.S. Survey Feet

### SKETCH OF REFERENCE TIES

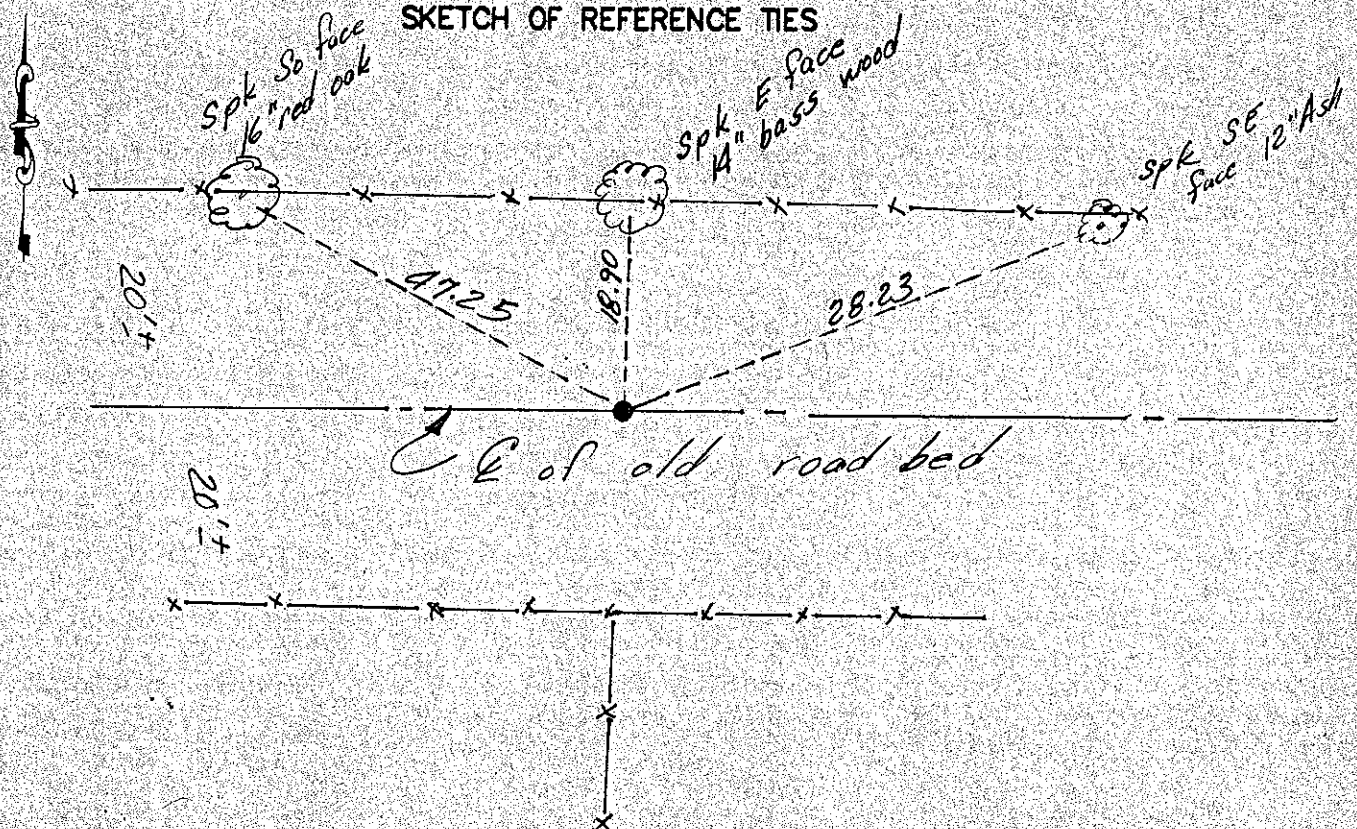

Statement of evidence relative to this corner location is on back of page.

I hereby certify that this document and the data contained herein was prepared by me or under my direct supervision.

*Ernest J. Red*  
Signature

1-1-13  
Date

Registration No. 9808

Land Surveyor,  Professional Engineer

County Surveyor,  County Engineer

### OFFICE OF THE COUNTY RECORDER

County of \_\_\_\_\_

I hereby certify that this document was filed in the County Recorder's office at \_\_\_\_\_ M. on the \_\_\_\_\_ day of \_\_\_\_\_ A.D. 20\_\_\_\_

County Recorder \_\_\_\_\_

BY \_\_\_\_\_ Deputy

DOCUMENT NO. \_\_\_\_\_

The original Government post was set by Deputy Surveyor John M Gley in September 1851 and 2 bearing trees noted as:

10" Pine bearing North 18° East at 10 links

6" Birch bearing South 40° West at 4 links

No visible evidence remains today for the post or its accessories.

This corner falls on the centerline of an old roadbed running east and west and the centerline of the fence running south. There is a record of a road opening along north line of sections 15 and 14 dated June of 1914 but no survey was made. Clifford Holmstrom owner of land on both sides of the corner in Section 15 stated that his dad constructed the fence running south from the corner and they always felt that this was where the corner was. Therefore we set a ½" iron pipe at this location, took ties and established Kanabec County coordinates on this position. Running the north south centerline of Section 15 we found the fence to be very close to the line and the centerline of the township road running from the center of section 15 to south quarter corner also agreed.